

## **ALL 2014 FZ09 MODELS**

FACTORY MODIFICATION CAMPAIGN – Headlight Does Not Work  
Yamaha Technical Bulletin M2014-014R

### **Affected Models:**

FZ09E

RN33E-0000002~0004427

FZ09EC

RN33Y-0000011~0001235

### **The reason for this recall:**

In affected motorcycles, the headlight lead wire can be stretched when the handlebars are turned fully to the left or right. This is due to insufficient length of the headlight lead wire. If this happens repeatedly, the headlight coupler may disconnect from the headlight bulb or the headlight lead wire may break near the coupler. If this happens, the headlight would malfunction, which could result in the possibility of a crash with injury or death.

### **What Yamaha and your dealer will do:**

To correct this defect, your authorized Yamaha dealer will add a headlight bulb sub-lead harness to provide proper lead wire length. There will be no charge to you for this procedure. The procedure takes about 45 minutes to perform, but your dealer may need to keep your motorcycle longer depending upon their schedule.

### **What you should do now:**

Please call your Yamaha dealer to make a service appointment to have this procedure performed. At that same time, you can find out how long they expect to keep your motorcycle for this service. If possible, take a copy of this notice with you when you take in your motorcycle. You should not ride your 2014 FZ09E or EC model until this modification is performed. If you are unable to return to the Yamaha dealer who sold you the motorcycle, this service will be performed by any authorized Yamaha Motorcycle dealer. For the name of a dealer near you, call 1-800-88-YAMAHA or visit the “Find a Dealer” section of this website.